


Compound Cut Conversion Table

Miter Cut	38° Crown		45° Crown		Miter Cut	38° Crown		45° Crown	
	Miter Angle	Bevel Angle	Miter Angle	Bevel Angle		Miter Angle	Bevel Angle	Miter Angle	Bevel Angle
1	0.6	0.8	0.7	0.7	31	20.3	23.9	23.0	21.4
2	1.2	1.6	1.4	1.4	32	21.0	24.7	23.8	22.0
3	1.9	2.4	2.1	2.1	33	21.8	25.4	24.7	22.7
4	2.5	3.2	2.8	2.8	34	22.6	26.2	25.5	23.3
5	3.1	3.9	3.5	3.5	35	23.3	26.9	26.3	23.9
6	3.7	4.7	4.3	4.2	36	24.1	27.6	27.2	24.6
7	4.3	5.5	5.0	4.9	37	24.9	28.3	28.1	25.2
8	5.0	6.3	5.7	5.7	38	25.7	29.0	28.9	25.8
9	5.6	7.1	6.4	6.4	39	26.5	29.7	29.8	26.4
10	6.2	7.9	7.1	7.1	40	27.3	30.4	30.7	27.0
11	6.8	8.7	7.8	7.8	41	28.2	31.1	31.6	27.6
12	7.5	9.4	8.6	8.5	42	29.0	31.8	32.5	28.2
13	8.1	10.2	9.3	9.2	43	29.9	32.5	33.4	28.8
14	8.7	11.0	10.0	9.9	44	30.7	33.2	34.3	29.4
15	9.4	11.8	10.7	10.6	45	31.8	33.9	35.3	30.0
16	10.0	12.5	11.5	11.2	46	32.5	34.5	36.2	30.6
17	10.7	13.3	12.2	11.9	47	33.4	35.2	37.2	31.1
18	11.3	14.1	12.9	12.6	48	34.4	35.9	38.1	31.7
19	12.0	14.9	13.7	13.3	49	35.3	36.5	39.1	32.3
20	12.6	15.6	14.4	14.0	50	36.3	37.1	40.1	32.8
21	13.3	16.4	15.2	14.7	51	37.2	37.8	41.1	33.3
22	14.0	17.2	15.9	15.4	52	38.2	38.4	42.2	33.9
23	14.7	17.9	16.7	16.0	53	39.3	39.0	43.2	34.4
24	15.3	18.7	17.5	16.7	54	40.3	39.6	44.2	34.9
25	16.0	19.5	18.3	17.4	55	41.3	40.2	45.3	35.4
26	16.7	20.2	19.0	18.1	56	42.4	40.8	46.4	35.9
27	17.4	21.0	19.8	18.7	57	43.5	41.4	47.4	36.4
28	18.1	21.7	20.6	19.4	58	44.6	41.9	48.5	36.8
29	18.8	22.5	21.4	20.1	59	45.7	42.5	49.6	37.3
30	19.6	23.2	22.2	20.7	60	46.8	43.0	50.8	37.8

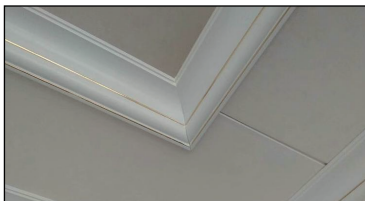

specifications subject to change.

A Perfect Crown Molding With Your saker Protractor

- 1) Measure the corner near the ceiling. Note the Miter Cut value from the dial (inner scale).
- 2) Determine the spring angle (information available where you purchase your crown molding stock) .
- 3) Refer to the compound cut conversion table (see back).
Locate the row with the same "Miter Cut" value as your corner measurement.
- 4) Note the "Miter Angle" and "Bevel Angle" from the row that corresponds to the spring angle of your work piece stock (38° or 45°).
- 5) Refer to the table below and carefully set the miter angle and bevel angle on your compound miter saw, then position your work piece with reference to the blade and fence, as indicated. Then, cut your first work piece.
- 6) Reset the saw and position your second work piece as indicated by the table below. Then, cut your second work piece.



the two work pieces should align perfectly for you crown molding.

Settings and Layout to Cut Crown Molding with a Compound Miter Saw

Inside Corner

Left Piece	Right Piece
Miter Swing: Right	Miter Swing: Left
Bevel Swing: Left	Bevel Swing: Left
Work Piece Location: Left of Blade	Work Piece Location: Left of Blade
Molding Edge Against Fence: Top	Molding Edge Against Fence: Bottom

Outside Corner

Left Piece	Right Piece
Miter Swing: Left	Miter Swing: Right
Bevel Swing: Right	Bevel Swing: Right
Work Piece Location: Right of Blade	Work Piece Location: Right of Blade
Molding Edge Against Fence: Bottom	Molding Edge Against Fence: Top